
ISOLATED OUTPUT HIGH PRECISION CURRENT SHUNT METER






GW Instek rolls out the new PCS-10001 isolated output high precision current shunt meter, which inherits the simultaneous voltage and current measurement function of PCS-1000. PCS-10001 adopts five sets of independent shunt resistors to provide five current measurement levels, including 300A, 30A, 3A, 300mA, and 30mA to meet the requirements of different current level measurements. Internally, PCS-10001 utilizes two sets of 24bits ADCs and low temperature coefficient electronic components to mainly focus on the current measurement of power supply devices. High precision PCS-10001 can be used in adjusting and calibrating instruments. Additionally, temperature variation will not cause PCS-10001 to yield any measurement errors. PCS-10001 can automatically select optimal measurement level with the maximum resolution so as to replace manual selection to save operational time.

PCS-1000I provides a BNC output, which can connect with an oscilloscope to directly observe current waveform variation without using a current probe. General oscilloscopes do not have isolated channels and their input and output are structured at a common point, therefore, the output load will likely result in measurement errors. PCS-1000I's isolated current output design can prevent measurement errors from an oscilloscope with non-isolated outputs. PCS-1000I, a high precision AC/DC current shunt meter, not only provides USB and GPIB communications interfaces for users to remotely control the instrument but also conducts simultaneous voltage and current measurements. The SCPI communications commands of PCS-1000I allow users to remotely control PCS-1000I via a PC to operate measurement data readbacks.



PCS-1000I high precision AC and DC shunt meter can simultaneously measure current and voltage with the maximum 6 1/2 measurement resolution. The above diagram shows the connection method of simultaneous measurement. Compared with the test of conventional meters from other brands, PCS-1000I is simple in connection and there is no requirement of any additional instrument.

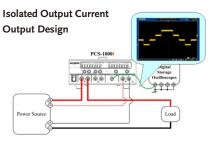


PCS-1000I adopts isolated current output design. Its BNC output can directly connect with an oscilloscope to avoid measurement errors resulted from the common ground of oscilloscope's analog input measurement.

Connection Comparison


PCS-1000I can simultaneously measure current and voltage with 6 1/2 measurement resolution. The below diagram shows the connection method of simultaneous measurement. Compared with the test of conventional meters from other brands, PCS-1000I is simple in connection and there is no requirement of any additional instrument.

PCS-1000I Conducts Simultaneous Voltage and Current Measurement




- Only one PCS-1000I is needed to measure voltage and current
- 2.Easy connection
- 3.USB and GPIB communications on the rear panel can be used for data communication while connecting with a PC

Shunt Resistor Conducts Current and Voltage Measurement



- One voltage meter is needed to measure voltage on shunt and the voltage will be converted to current.
 For simultaneous voltage and current measurement, one extra voltage meter is required
- 2.Complex connection
- For data communication with a PC, the PC must be connected to two voltage meters

Conventional Shunt Meter Conducts Current and Voltage Measurement

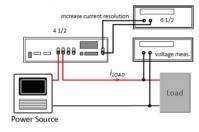

- 1.This method requires one shunt meter, one current meter to increase current measurement resolution, and one voltage meter to measure voltage
- 2.Complex connection
- For data communication with a PC, the PC must be connected to two meters

PCS-1000I

FEATURES

- 6 1/2 Digit Voltage and Current Measurement Resolution
- Simultaneous Current and Voltage Measurement
- Five Current Measurement Levels(AC & DC): 30mA/300mA/3A/30A/300A
- AC Voltage Measurement Levels : 200mV/2V/20V/200V/600V
- DC Voltage Measurement Levels : 200mV/2V/20V/200V/1000V
- Standard: USB & GPIB
- CE Verification



Front Panel



Rear Panel



PCS-1000I vs. Current Probe for Measurement

APPLICATIONS

- Power Supply Analysis
- Power Supply Measurement Application
- R & D and Laboratory Application
- Quality Inspection Test
- Precision Measurement



DC	DC Voltage	Range	Half Year 23	3 °C ± 5 °C	Terr	perature Coefficient/°C	
CHARACTERISTICS		200.0000 mV		0.0050 + 0.0035		0.0005 + 0.0005	
		2.000000 V	0.0050 + 0.0053			0.0005 + 0.0001	
		20.00000 V	0.0050 + 0.0010			0.0005 + 0.0001	
		200.0000 V	0.0050 + 0.0010		0.0005 + 0.0001		
		1000.000 V	0.0050 + 0.0020		0.0005 + 0.0001		
		Accuracy specification : \pm (% of reading + % of range); voltage input resistance: $10M\Omega$ for all DC voltage range					
	DC Current	Range	Burden Voltage Half Year 23 °C ± 5 °C			Temperature Coefficient/°C	
		30,00000 mA	< 0.4 V 0.01 + 0.005		0.001 + 0.002		
		300,0000 mA		< 0.5 V 0.01 + 0.005		0.001 + 0.002	
		3.000000 A	< 0.8 V	0.01 + 0.005 0.01 + 0.005		0.001 + 0.002	
		30.00000 A*1	< 0.8 V			0.001 + 0.002	
		300,0000 A*1	< 0.8 V	0.02 + 0	0.005	0.001 + 0.002	
			curacy specification : ± (% of reading + % of range)				
	Isolated DC Current	Range	Half Year 23 °C ± 5 °C DC Accuracy			Temperature Coefficient/°C	
	Monitor Accuracy	30.00000 mA	0.1 + 0.05 0.1 + 0.05		0.001		
		300.0000 mA				0.001	
		3.000000 A		0.1 + 0.05 0.1 + 0.05		0.001	
		30.00000 A*1				0.001	
		300.0000 A*1	0.2 + 0.05		0.001		
		Accuracy specificatio	on: \pm (% of output + % of full scale);monitor output vo			t voltage for the full scale current =	
AC CHARACTERISTICS	True RMS AC Voltage	Range	Frequency	Half Year 23 °C ± 5 °C		Temperature Coefficient/°(
		200,0000 mV			0.005 + 0.005		
		2.000000 V	45Hz~2kHz	1.0 + 0.05		0.005 + 0.005	
		20.00000 V	2kHz~10kHz			0.005 + 0.005	
		200.0000 V	10kHz~20kHz			0.005 + 0.005	
		600,000 V				0.005 + 0.005	
		Accuracy specification : \pm (% of reading + % of range)					
	True RMS AC Current	Range	Frequency	Half Year 23 °C ± 5 °C		Temperature Coefficient/°C	
		30,00000 mA	4511 0111	0.5.0	. 0.5	0.03 + 0.006	
		300,0000 mA		45Hz~2kHz 0.5 + 0.05 2kHz~10kHz 1.0 + 0.05	0.03 + 0.006		
		3.000000 A	2kHz~10kHz		0.05	0.03 + 0.006	
		30,00000 A*1 300,0000 A*1	45Hz~400Hz	0.5 + 0.05		0.03 + 0.006	
						0.03 + 0.006	
		Accuracy specificatio	cation: ±(% of reading + % of range)				
	Isolated AC Current Monitor Accuracy	Range	Frequency	Half Year 2 AC Acci		Temperature Coefficient/°C	
		30.00000 mA	4511 0111	0.2 + 0.05 0.5 + 0.05	0.001		
		300,0000 mA	45Hz~2kHz		0.001		
		3.000000 A	2kHz~10kHz 0.5 +	0.5 + 0	0.05	0.001	
		30.00000 A*1	45Hz~400Hz	0.5 + 0.05	0.05	0.001	
		300.0000 A*1	43112 400112	0.5 + 0	7.03	0.001	
	Accuracy specification: \pm (% of output + % of full scale); monitor output voltage for the full = 3V; The specifications are only applicable when the input is 10% or greater of the full scal						
GENERAL	Power Supply Power Line Frequency Operating Environment	100 V/120 V/220 V/240 V \pm 10% 50/60 Hz Full accuracy for 0 °C ~ 55 °C, Full accuracy to 80% R.H. at 40 °C -40 °C ~ 70 °C Max 35VA 210(W) x 80(H) x 390(D)mm ; Approx. 5 kg					
	Storage Environment						
	Power Consumption Dimensions Weight						

ORDERING INFORMATION

PCS-1000I Isolated Output High Precision Current Shunt Meter

Quick Operation Guide, User Manual (CD) x 1, AC Power Cord x 1 (Region Dependant),

GTL-105A Alligator Clip Test Lead (3A Max) GTL-240 USB Cable

GTL-207 Banana Plug Test Lead PCS-001 Basic Accessory Kit OPTIONAL ASSESSORIES

GRA-419-J Rack Mount Adapter (JIS) GRA-419-E Rack Mount Adapter (EIA)

